



Technical Service Bulletin

Cobra Motorcycle Mfg.


11511 Springfield Road
North Lima, Ohio 44452

(330) 549-9600 phone
(330) 549-9605 fax

TSB1104: 2004 King kick lever set screw

April 2, 2004

The setscrew on the 2004 King 50 can vibrate out. This can allow the spring and detent ball to become lost.

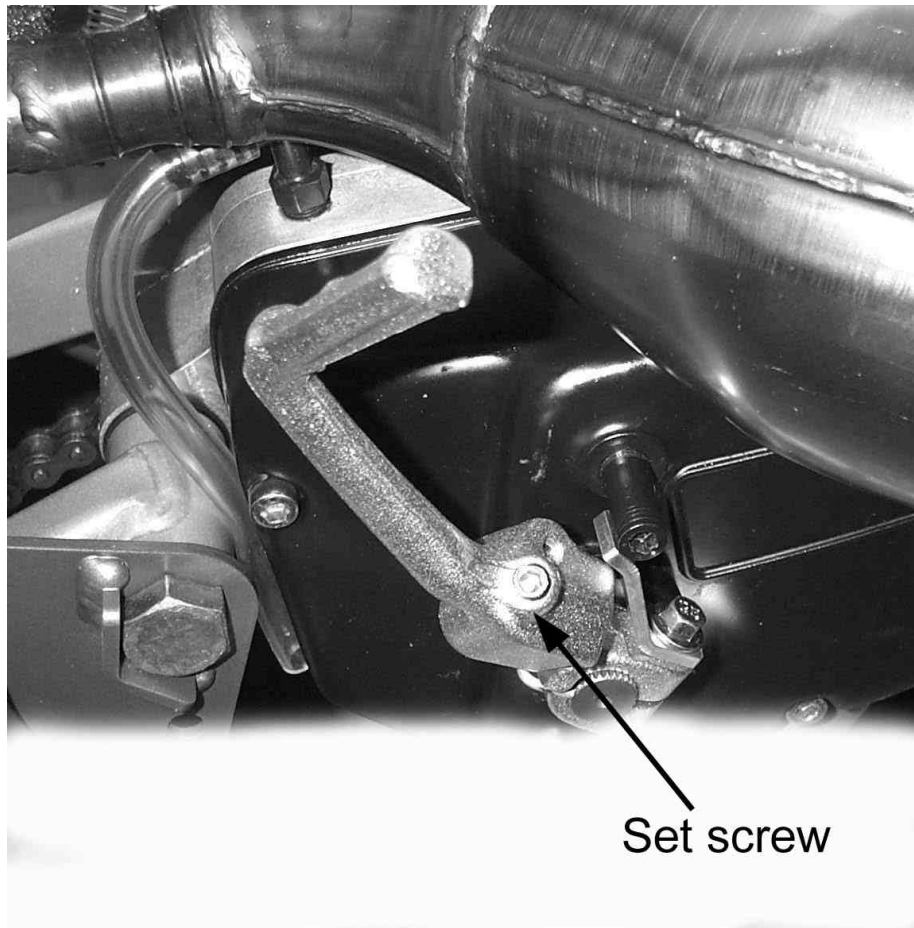

It is advisable to install some thread locking agent to the threads of the set screw when it is adjusted to the desired setting (set screw positioning in and out determines the ease with which the kick lever can be rotate into position).

Cobra has replacement ball, spring, set screw kits available if necessary.