



Technical Service Bulletin

Cobra Motorcycle Mfg.

11511 Springfield Road
North Lima, Ohio 44452

(330) 549-9600 phone
(330) 549-9605 fax


TSB1304: 2004 CM & King secondary shaft bearing retainer

April 2, 2004

There is a slim chance (but possible none the less) that the secondary shaft bearing retainer (screw) can back out of it's intended position.

▲ WARNING

If this retainer comes out of position it can cause an immediate stop to the motorcycle and has to potential to cause substantial damage to the engine.

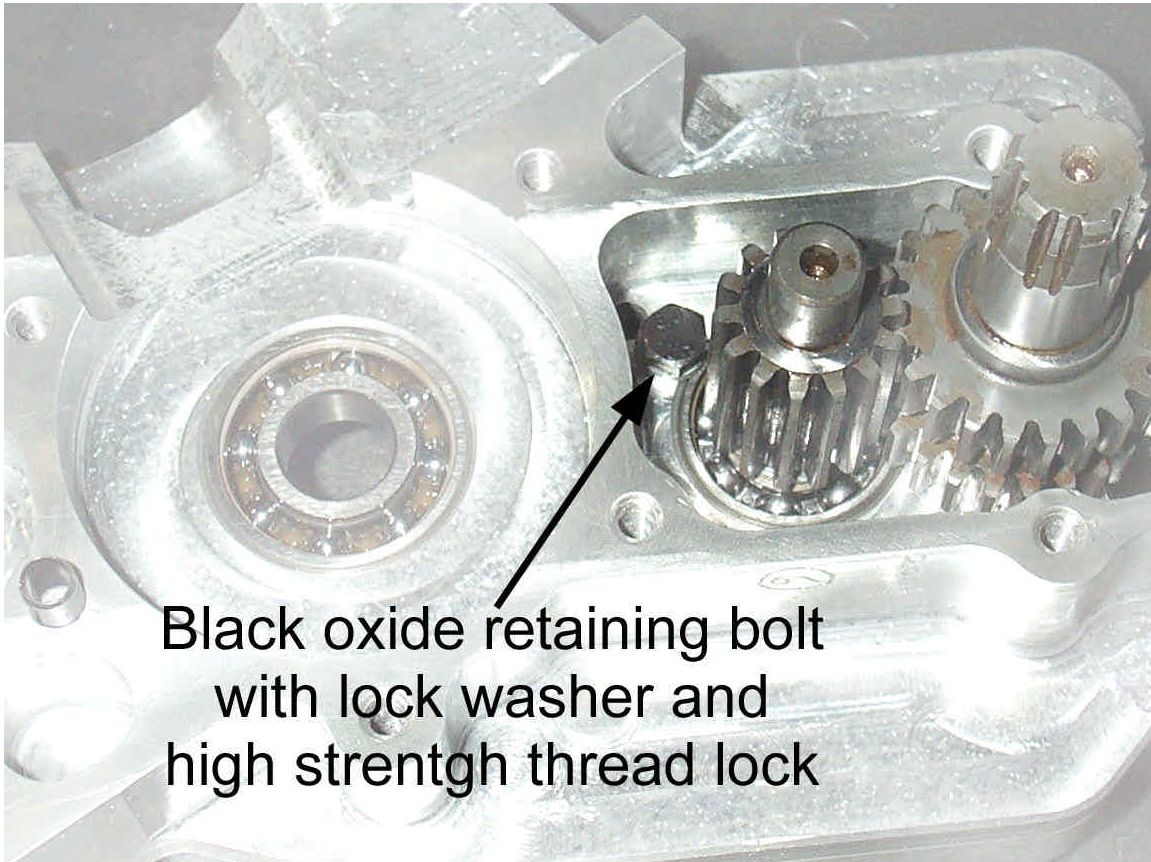

The early button head screw (with high strength thread locking agent) has been replaced with a black oxide bolt, lock washer, and high strength thread locking agent.